



# 30 INCH COUNTER DEPTH BOTTOM-FREEZER REFRIGERATOR

#### **BRFB21622SS**





Climatic class

Cooling Gas

Annual energy consumption, kwh/year



GEI	NERAL
Cooling system	Frost Free Cooling
Control system	Electronic Control Display
Reversible door	Yes
Finish	Smudge free, fingerprint resistant Stainless Steel
CAP	ACITIES
Total net volume, cu. ft.	16.1
Fresh food net volume, cu. ft.	10.9
Freezer net volume, cu. ft.	5.2
FRIDGE	FEATURES
Blue light technology	Yes
Electronic control display type	Digital Display on ceiling
Auto defrost	Yes
Inner illumination	LED-Ceiling
Door Open Alarm	Yes
Shelves	2 - Safety Glass
Crispers	2
Door Racks	5 (4 half-width, 1 full)
Sabbath Mode	Yes
Compressor	Variable Speed VCC
FREEZEF	R FEATURES
Auto defrost	Yes
Freezer drawers	2
Automatic Ice Maker w/tap water connection	Makes up to 6.5 lbs/day
TECHNICAL	INFORMATION
Supply voltage, V/Hz	120V/ 60Hz
Rated current, A	2.0
Noise level, dBA	44
DIME	NSIONS
HxWxD, in	69 11/16" x 29 3/4" x 27 9
Product weight, lbs.	188
HxWxD, cm	177 x 75.6 x 70
Product weight, kg	85
PERFC	DRMANCE
Energy Star qualified	Yes



T 364

R600a








#### 30 INCH COUNTER DEPTH BOTTOM-FREEZER REFRIGERATOR


### **BRFB21622SS**

## **Dimensions and Installation**

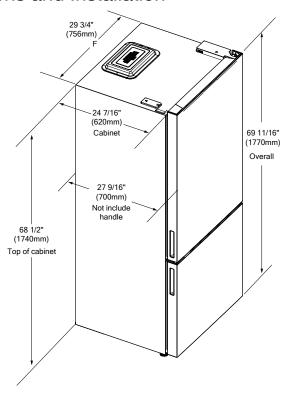

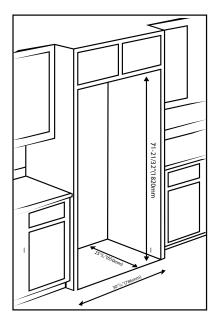

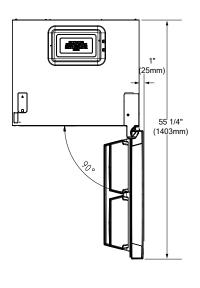

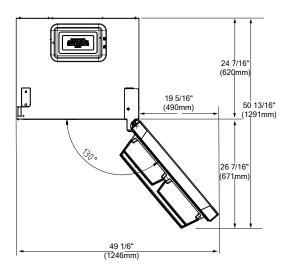

Required Minimum Clearances:

Top: 2"

Sides: 1/2" on each side

Back: 1 3/16"

NOTE TO THE INSTALLER: All height, width and depth dimensions are shown in inches (as well as metric). Beko US Inc. reserves the absolute and unrestricted right to change product materials and specifications, at any time, without notice. Please visit our website www.blombergappliances.com or call 888-352-2356 to verify the latest specifications with final dimensional data and other details prior to installation and making a cutout. Applicable product limited warranty information may be found in accompanying product materials or you may contact your account manager for further details. Proper installation is the responsibility of the installer. Product failure due to improper installation is not covered under the Limited Warranty.

